NetBotz® Rack Monitor 250 NBRK0250



APC, the APC logo, NetBotz, PowerNet, StruxureWare, and EcoStruxure are trademarks owned by Schneider Electric SE. All other brands may be trademarks of their respective owners.

What's in This Document

Affected Revision Levels	1
Device IP Configuration Wizard	2
Supported Browsers	2
New Features	2
Fixed Issues	3
Known Issues	4
Miscellaneous	7
Recovering from a Lost Password	7
Update the Appliance	8
Update the Wireless Sensor Network	9
PowerNet MIB Reference Guide	9
Hash Signatures	9

Affected Revision Levels

Component	Version	Details
APC Operating System	apc_hw05_aos_704.bin	Network Management Card (NMC) Operating System & TCP/IP Stack for Hardware Platform v05.
NetBotz 250 Application	apc_hw05_nb250_706.bin	NetBotz 250 Application
PowerNet [®] Application	powernet440.mib	PowerNet SNMP Management Information Base (MIB)

As standards, specifications, and design change from time to time, please ask for confirmation of the information given in this publication. © 2016 – 2021 APC. All rights reserved.



Device IP Configuration Wizard

The Device IP Configuration Wizard is a Windows[®] application designed specifically to remotely configure the basic TCP/IP settings of Network Management Cards. The Wizard runs on Windows 2000, Windows Server[®] 2003, Windows Server 2012, and, on 32- and 64-bit versions of Windows Vista[®], Windows XP, Windows Server 2008, Windows 7, Windows 8, and Windows 10 operating systems. This utility supports cards that have firmware version 3.X.X or higher and is for IPv4 only.

The Wizard is available as a free download from the APC website, www.apc.com:

- 1. Go to www.apc.com/tools/download and select Software Upgrades Wizards and Configurators from the Filter by Software/Firmware drop-down list
- 2. Click Submit to view the list of utilities available for download.
- 3. Click **Download** to download the **Network Management Device IP Configuration Wizard**.

Supported Browsers

Most modern Web browsers are compatible with the Rack Monitor 250 Web UI. Use the most recent version of your Web browser to mitigate the risk of software security vulnerabilities.

New Features

APC Operating System (apc_hw05_aos_704.bin)

- Changed the SSL self-signed certificate "Valid To" year to 2035 (from 2022).
 NOTE: If you currently use an internally generated self-signed certificate and wish to extend its use past 2021, you must delete the current certificate and reboot the network interface (NMC). This allows the NMC to generate a new certificate with a "Valid To" year of 2035.
- Create users via configuration file (config.ini). Introduced a set-only keyword in the [SystemUserManager] section, "CreateUser," which allows a user account to be added to the system.
 NOTE: The user can only be added, not edited nor deleted, in this way.
- **DHCP re-lease configuration.** Added a new DHCP option in Web UI and CLI to allow you to determine if you want the NMC to retrieve the vendor-specific file again after subsequent DHCP leases are assigned.

NetBotz 250 Application (apc_hw05_nb250_706.bin)

None. This release was implemented to address security vulnerabilities.

Fixed Issues

APC Operating System (apc_hw05_aos_704.bin)

This release includes remediation for various vulnerabilities which include multiple cross-site scripting vulnerabilities, potential disclosure of non-sensitive data (debug file), and account manipulation by administrator-level or higher accounts.

NetBotz 250 Application (apc_hw05_nb250_706.bin)

- 1. The misalignment of Modbus register map has been addressed.
- 2. If one door has been unlocked with a mechanical key, users can now access the other door with a registered Rack Access card.
- 3. The event text for temperature threshold violations now shows correct measurements when displayed in degrees Fahrenheit.
- 4. The "Threshold Settings" page for the Temperature and Temperature/Humidity sensors (AP9335T and AP9335TH) now accepts Fahrenheit values greater than 99°.

Known Issues

APC Operating System (apc_hw05_aos_704.bin)

If your Data Center Expert firmware version is earlier than 7.8.1, the Launch to device option may not work for NMC devices with AOS v694 or later. If your Data Center Expert firmware version is 7.8.1 or later, the Launch to device option works for NMC devices with all AOS versions.

NetBotz 250 Application (apc_hw05_nb250_706.bin)

Updates and upgrades

- 1. **Upgrade the NetBotz Rack Monitor 250 firmware before first use.** Download the most recent version of the NetBotz Rack Monitor 250 firmware from www.apc.com. See Update the Appliance, page 8 for basic instructions, or see the *User Guide* on www.apc.com for detailed instructions to upgrade the firmware.
- 2. Upgrade the NetBotz Wireless Sensor firmware before first use. Download the NetBotz Wireless Firmware Update Utility from www.apc.com or help.ecostruxureit.com. Install the Utility as an administrator and see Update the Wireless Sensor Network, page 9 or the *User Guide* on www.apc.com for information on how to upgrade the wireless sensors on your Rack Monitor 250 wireless network.

NOTE: You must upgrade the wireless sensors on one Rack Monitor 250 at a time, using the coordinator and sensor(s) from its wireless network.

- Update the NetBotz 250 Data Center Expert (DCE) Scanner Device Definition File (DDF) to a version more recent than 6: Verify the DDF used by DCE under Device > SNMP Device Communication Settings > Device Definition Files. The most recent scanner DDF version is 17. Contact your local technical support for an up-to-date scanner DDF.
- 4. Rack access devices are temporarily removed from the user interface during the firmware update. The firmware update for the Rack Monitor 250 happens first, then the update for the rack access devices follows. Once the Rack Monitor 250 firmware update completes, it takes about ten minutes for the rack access devices to reappear in the list. All configured settings remain as expected.
- 5. Do not reboot the appliance while a firmware upgrade is in progress. When a Sensor Pod 150 is connected to the appliance, an informational alarm occurs and error messages are reported on the home page for connected sensors while the Sensor Pod's firmware upgrades. The errors clear and accurate status messages are displayed after the upgrade. The status of the upgrade process can be viewed from Configuration > Device > NetBotz in the Web UI.
- 6. If the appliance is downgraded to firmware v6.6.7 or lower, the wireless coordinator status and wireless sensor commission list may not display correctly. To correct the display, wait until the download is complete, then reboot the network management interface.

StruxureWare Data Center Expert® (DCE) and EcoStruxure IT Gateway®

- 1. **Unplugged sensors in DCE can be deleted**. NetBotz Rack Monitor 250 alarm generation enabled/disabled sensors reporting as unplugged in DCE can safely be deleted. Humidity sensors reporting as unplugged on temperature-only sensors can also safely be deleted. These sensors were erroneously included in the device definition file (DDF), and have been removed in version 16 and newer.
- 2. DCE and EcoStruxure IT Gateway[®] do not include support for the NetBotz 250 outputs (beacon, switched outlet, output relay). Support for these features is planned for future updates of DCE and EcoStruxure IT.
- EcoStruxure IT Gateway does not automatically update user-configured values (sensor names, for example). To update these values in EcoStruxure IT Gateway, click the menu icon, select **Discovery**, then select **RUN** to rediscover the updated Rack Monitor 250.

Sensors, pods, and rack access devices

- 1. The Mifare Classic 7-byte card format is vulnerable to cloning. If you use this format, maintain the physical security of your equipment and access cards. Consider updating to the Mifare Plus format.
- 2. The NetBotz Sensor Pod 180 (NBPD0180) is not supported by the NetBotz 250 appliance. The Sensor Pod 180 will not be supported on firmware v6.5.0 and later.
- 3. Attempting to filter discrete state wired sensors (leak, vibration, smoke, door, or contact sensors) via the "Create Filter" button in the Web UI may result in an error that prevents the filter from being created.
- 4. Some events, including "Sensor disconnected" and "Sensor configuration updated", may not be generated for the voltage sensor.
- 5. If sensors are connected to all six ports on the Rack Monitor 250, the NB Module page may not display all six sensors. You can view all connected sensors on the Home page. You can also view connected sensors by selecting Configuration > Device > Wired Sensor. To find the NB Module page, go to Configuration > Device > NetBotz and select the Module Name.
- 6. After replacing a sensor with a different type of sensor, you must reboot the Rack Monitor 250 to display the new sensor correctly.
- 7. After replacing a sensor with a different sensor, the name of the previously connected sensor is displayed. This is not resolved by rebooting the Rack Monitor 250. The sensor will report accurate values as expected.
- 8. Sensors connected to a Sensor Pod 150 can be mapped for the beacon only, and not for the switched outlet or output relay. Door switch sensors connected to Door 1 or Door 2 ports can be mapped for the beacon only, and not for switched outlet or output relay. Alarm mapping is not available for any wireless sensors.
- 9. State sensors do not appear in the data log. Wireless sensors and Sensor Pod 150 devices without at least one numeric sensor do not appear in the data log filtering list.
- 10. When a rack access handle and door switch are left open for longer than the time specified in the Door Open Alarm Threshold, the auto relock alarm occurs rather than the door open alarm.
- 11. The automatic card-format recognition feature cannot distinguish between card formats that have the same ID length. For example, these two card formats have the same ID length: H10302 37 bit w/o facility code, and H10304 37 bit w/ facility code. By default, the appliance expects H10302 cards, so H10304 cards are automatically registered as H10302 cards. If someone manually changes the expected card format to H10304, the appliance will not recognize any cards registered as H10302.

The following supported card formats have the same ID lengths:

	37-bit ID	7-byte ID
Default format	H10302 - 37 bit w/o facility code	Mifare Classic 7 byte
	H10304 - 37 bit w/ facility code	Mifare Plus
		Mifare DESFire

If your cards are a non-default format, manually select the expected card format from **Configuration > Device > Rack Access > Lock Properties** before swiping the first card. This will ensure the appliance registers the correct card format.

Miscellaneous

- 1. A full config.ini file may take up to 20 minutes to load. A config.ini file with a 200-user [AccessPXUser] section may take up to 10 minutes to load.
- Unable to communicate with the appliance using the USB console port. You may need to install a serialto-USB driver to communicate with the Rack Monitor 250. The driver is available for download from the USB vendor FTDI. For more information, see the FAQ article *NetBotz 250* | *Serial Connection (Driver + Serial Parameters)* (FA381275). You can search for FAQ articles on apc.com/support. Select FAQ's under Resources and Tools, then enter the article title or ID in the Search bar.
- 3. The management interface may reboot when receiving a config.ini file with 200 rack users if over 20 alarms are active. To avoid this, upload the [AccessPXUser] section separately: first upload config.ini without the [AccessPXUser] section, then upload config.ini with only the [AccessPXUser] section.
- 4. The wirelessSensorConfigName OID allows values with more than 20 characters. Sensor names will be truncated in interfaces that enforce the 20-character limit.
- 5. The message "NB: Communication established" is not received by SNMP traps or syslog.
- 6. Disabling an individual event for email notification may cause an unexpected network interface restart.
- 7. Modifying RADIUS settings via config.ini may cause an unexpected network interface restart.
- 8. The NMC may experience an unexpected network interface restart while editing a firewall policy.
- 9. Modifying large groups of event actions by severity may cause an unexpected network interface restart.
- 10. IPv6 connectivity outside of local subnet does not work in all environments.
- 11. SNMPv3 communication and monitoring on some third party SNMP management tools such as ManageEngine OpManager does not work properly.
- 12. SNMP traps do not work for some AOS events.
- 13. File transfers using SCP do not work properly with WinSCP client
- 14. Certain privileges in the CLI are not consistent with the user privileges in the Web UI.
- 15. The Trap receiver NMS settings incorrectly allow for a NULL entry.
- 16. SNMP Trap Recipients are activated only after a previous Trap recipient can send Traps.
- 17. Firewall rules configured through the Web UI are active even when the firewall is not enabled. A fix to this issue is planned for an upcoming release.

Miscellaneous

Recovering from a Lost Password

You can use a local computer (a computer that connects to the Rack Monitor 250 through the serial port) to access the Command Line Interface (CLI) to reset the user name and password:

- 1. Select a serial port at your local computer and disable any service using that port.
- 2. Connect the USB A–USB mini B configuration cable to the console port on the Rack Monitor 250 and to a USB port of the computer.

NOTE: You may need to install a serial-to-USB virtual COM port driver. The USB vendor is FTDI; the driver type is VCP. Driver downloads are available on the FTDI Chip website. For more information, see the FAQ article *NetBotz 250* | *Serial Connection (Driver + Serial Parameters)* (FA381275). You can search for FAQ articles on apc.com/support. Select **FAQ's** under **Resources and Tools**, then enter the article title or ID in the Search bar.

- 3. Open a terminal program (such as Tera Term, HyperTerminal[®], or PuTTY[®]), and configure the selected port with 9600 bps, 8 data bits, 1 stop bit, no parity, and no flow control.
- 4. Press Enter, repeatedly, until the User Name prompt is displayed. If the User Name prompt is not displayed, verify the following:
 - The serial port is not in use by another application.
 - The terminal settings are correct as specified in step 3.
 - The correct cable is being used as specified in step 2.
 - Scroll Lock is not turned on.
- 5. Press **Reset** button near the power LED once. The Status LED will flash orange and green within 5–7 seconds of pressing the **Reset** button. When the Status LED begins flashing, immediately press the Reset button a second time to temporarily reset the user name and password to their defaults.
- 6. Press Enter, repeatedly if necessary, to display the User Name prompt again, then log on with the default user name and password (**apc** and **apc**). If you take longer than 30 seconds to log on after the User Name prompt is displayed, you must repeat step 5 and log on again.
- 7. At the CLI, use the following commands to change the password from **apc** to a value of your choice:

user -n apc -cp apc -pw <user password>

Example: to change the Super User's password to p@ssword, enter user -n apc -cp apc -pw p@ssword

NOTE: For security reasons, it is possible to disable the Super User account. To verify that the Super User account is enabled, enter user -n apc -e

If the account is disabled and the current password is p@ssword, you can enter user -n apc -e enable -cp p@ssword to enable the Super User account.

8. Enter the command quit, exit, or bye to log off. Reconnect any serial cable you have disconnected, and restart any service you have disabled.

Update the Appliance

It is recommended that you update the Rack Monitor 250 firmware to the most recent version before first use.

- 1. Download the latest firmware version free from www.apc.com/tools/download or help.ecostruxureit.com. If you have a Windows computer, you can use the firmware executable to upgrade the firmware. If you have any other type of computer, you must use FTP, SCP, or XMODEM to manually upload each firmware upgrade file to the Rack Monitor 250. You must upload these .bin files one at a time in this order:
 - a. Boot Monitor (bootmon), equivalent to the BIOS
 - b. APC Operating System (AOS), the Rack Monitor 250 operating system
 - c. Application Module, the NetBotz Rack Monitor 250 specific file

For more information about using FTP, SCP, or XMODEM to manually update the Rack Monitor 250 firmware files, see the *User Guide* on www.apc.com.

NOTE: Rack access devices are temporarily removed from the user interface during the firmware upgrade.

 When the upgrade has completed, log in to the Rack Monitor 250 and go to Configuration > Device > NetBotz. Once the status of all connected devices has changed from FW Upgrade to Normal (or Warning or Critical if there is an active alarm), and the rack access devices are displayed as expected, the Rack Monitor 250 is ready for use.

Update the Wireless Sensor Network

It is recommended that you update the Wireless Temperature Sensor firmware before first use.

 Download the NetBotz Wireless Sensor Update Utility. Go to www.apc.com, and select Support > Resources & Tools > Software/Firmware. Under Filter by Software/Firmware, select Software Upgrades - Software for NetBotz appliances.

NOTE: The Wireless Sensor Upgrade Utility is only available for Windows.

- 2. Install the Utility as an administrator.
- 3. Remove the plastic cover over the Wireless port. Remove the coordinator and connect it to a USB port on the computer where you installed the Utility.
- 4. Record the MAC address of the Wireless Temperature Sensor that came with the Rack Monitor 250. Turn on the Wireless Temperature Sensor.
- 5. In the Windows Start menu, type the following: NetBotz Wireless Update Utility. Right-click the Utility, and select Run as Administrator.

NOTE: The Utility may not execute correctly if you do not select **Run as Administrator**.

NOTE: If you are unable to launch the Utility, you may need to install a serialto-USB virtual COM port driver on your computer. The required driver is available in the "drivers" folder of the Utility.

- Enter the MAC address of the sensor in the commission list field. If you have more than one wireless sensor, make sure they are all turned on, and add their MAC addresses also. Click **OK** to start the Utility.
- 7. Browse to the wireless firmware .zip file installed with the Utility.
- 8. Click **Apply** to upgrade the wireless sensor firmware.
- 9. When the firmware upgrade is complete, reconnect the coordinator to the Rack Monitor 250 Wireless port and replace the plastic cover. DO NOT connect the coordinator to any other USB port on the appliance.

For more information about updating the wireless sensor firmware, see the documentation included with the Wireless Sensor Update Utility.

PowerNet MIB Reference Guide

The MIB Reference Guide, available on www.apc.com, explains the structure of the MIB, types of OIDs, and the procedure for defining SNMP trap receivers. For information on specific OIDs, use an MIB browser to view their definitions and available values directly from the MIB itself. You can view the definitions of traps at the end of the MIB itself (the file powernet440.mib is downloadable from www.apc.com).

Hash Signatures

apc_hw05_aos704_nb250706_bootmon109.exe

MD5	07acb7b99f0d1cebd9f73f643c2a98e5
SHA-1	b625fc6c1818b265bdd6cb70e201f3ce1ac9d69e
SHA-256	e079032c7fd42e495cc2be5bcccf105c0b41ea9c71ed5db04bfa560879b6613d